>Bolting Systems



SPX Hydraulic Technologies 5885 11th Street Rockford, IL 61109-3699 USA Order Entry: +1 800 541 1418 spxboltingsystems.com

Tech Services: +1 800 477 8326 Fax: +1 800 765 8326 Fax: +1 800 288 7031

Operating instruction - Parts List for:

FLS15 FLS15-ST

HYDRAULIC SPREADERS



TABLE OF CONTENTS

<u>SUBJECT</u>	<u>PAGE</u>	
SAFETY DEFINITIONS	3	
SAFETY PRECAUTIONS	3	
• Spreader	4	
GENERAL INFORMATION	4	
BENEFITS	5	
APPLICATIONS	5	
OPERATING INSTRUCTIONS	5	
Flange opening	5	
Flange closing	5	
RECOMMENDATION	6	
IMPORTANT	6	
WARNING	6	
CAUTION		
WEDGE USE		
DIMENSIONS / SPECIFICATIONS	8	
DISASSEMBLY / MAINTENANCE / SERVICE	9	
PARTS LIST	10	
SERVICE KITS	11	
DECLARATION OF CONFORMITY	12	

SAFETY DEFINITIONS

The safety signal word designates the degree or level of hazard seriousness.

DANGER: Indicates an imminently hazardous situation which, if not avoided, will result in death or serious injury.

WARNING: Indicates a potentially hazardous situation which, if not avoided, could result in death or serious injury.

CAUTION: Indicates a potentially hazardous situation which, if not avoided, may result in minor or moderate injury.

CAUTION: Used without the safety alert symbol indicates a potentially hazardous situation which, if not avoided, may result in property damage.

IMPORTANT: Important is used when action or lack of action can cause equipment failure, either immediate or over a long period of time

SAFETY PRECAUTIONS

WARNING: To prevent personal injury:

Read Instruction Manual before operation. For the latest revision of the instruction sheet please visit the "Resources" page on our Website.

IMPORTANT: For instructions specific to the various system components refer to the related individual instruction sheet.

IMPORTANT: The following procedures must be performed by qualified, trained personnel who are familiar with this equipment. Operators must read and understand all safety precautions and operating instructions included with equipment. If the operator cannot read these instructions, operating instructions and safety precautions must be read and discussed in the operator's native language.

• These products are designed for general use in normal environments. These products are not designed for lifting and moving people, agri-food machinery, certain types of mobile machinery, or in special work environments such as: explosive, flammable, or corrosive. Only the user can decide the suitability of this product in these conditions or extreme environments. Power Team will supply information necessary to help make these decisions. Consult your nearest Power Team facility.

Safety glasses must be worn at all times by the operator and anyone within sight of the unit. Additional personal protection equipment may include: face shield, goggles, gloves, apron, hard hat, safety shoes, and hearing protection. Check for local safety requirements and obey all safety rules and regulations in force at the job site.

The owner of this tool must ensure that safety-related decals are installed, maintained, and replaced if they
become hard to read.

SPREADER

DANGER: To prevent serious personal injury or death:

Do not exceed rated capacities of the spreader. Excess pressure may result in personal injury. **Maximum operating pressure is 700 bar (10,000 psi).**

- Avoid off-center loads that could damage the spreader and/or cause loss of the load.
- Read and understand all safety and warning decals and instructions for devices attached.
- Inspect each Spreader and coupler before each shift or usage to prevent unsafe conditions from developing.
- Do not use the Spreader if damaged, altered or in poor condition.
- Do not use the Spreader with bent or damaged couplers or damaged port threads.
- Avoid pinch points or crush points that can be created by the load or parts of the Spreader.

To help prevent personal injury, do not allow personnel to go under or work on a load before it is properly cribbed or blocked. All personnel must be clear of the load before lowering.

 Never use extreme heat to disassemble a hydraulic Spreader or cylinder. Metal fatigue and/or seal damage will result and can lead to unsafe operating conditions.

IMPORTANT:

- · Keep the Spreader clean at all times.
- When the Spreader is not in use, keep the shoes fully retracted.
- Use an approved, high-grade pipe thread sealant to seal all hydraulic connections. Teflon tape can be used
 if only one layer of tape is used and it is applied carefully (two threads back) to prevent the tape from being
 pinched by the coupler and broken off inside the pipe end. Any loose pieces of tape could travel through
 the system and obstruct the flow of fluid or cause jamming of precision-fit parts.
- Always use protective covers on disconnected guick couplers.

GENERAL INFORMATION

- The SPX Hydraulic Spreader is a hydraulically operated tool.
- The spreader uses the integrated wedge concept.
- It is used to spread flanges in order to create space for cleaning and repairing flange surfaces and gasket replacement.
- The spreader is actuated by a single acting cylinder.
- The spreader must be powered by an SPX hand pump.

BENEFITS

- Corrosion protected for offshore market by means of nickel plating.
- Easy to change wearing parts and easy to maintain.
- Quick adjustment to various tasks due to interchangeable shoes (serrated, stepped).

APPLICATIONS

Wedge spreaders can be used for: pipe and flange repair, removing of elbows, removing of couplers, gasket and metal seals replacement, maintenance/replacement of valve and control equipment, general spreading applications in the oil and gas industry, and general repair and maintenance.

OPERATING INSTRUCTIONS

FLANGE OPENING


- After loosening/removing flange bolts insert wedge spreader(s) at least up to the gripping surfaces of the spreader shoes and gradually apply pressure via the pump. Maximum operating pressure is 700 bar (10,000 psi). Visually check that flanges are seperating accordingly. At end of tool stroke insert stepped block before gradually reducing pressure on the wedge spreader.
- Repeat previous steps until you reach maximum flange opening possible with inserted stepped block (see fig. 2).


FLANGE CLOSING

- In order to close a flange you have to insert the spreader at ±80% stroke of tool. Take over the load from the stepped block onto the spreader before removing said stepped block one step back. Gradually reduce pressure to let the load be taken by the next smaller step of the stepped block.
- Repeat previous steps until you reach full flange closing. Replace and tighten flange bollts.

RECOMMENDATION

- It is recommended that two spreaders be used in tandem.
- Single spreader use is possible but depends on the job at hand.
- Tandem use will give an even spread to the joint.
- The spreaders should be set at 180° apart (see fig.1).
- The spreader needs to be inserted at least as far as the gripping surface to prevent wedge from slipping out.
- The spreader can be used throughout the whole of the shoes' gripping surfaces.

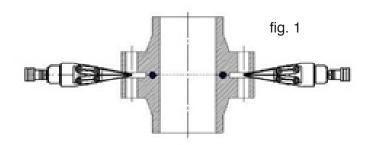

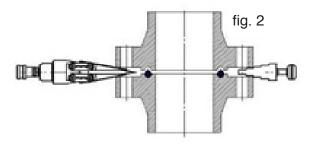

IMPORTANT

- Make sure the tool is in fully retracted closed position before inserting the flange spreader in between the flange faces in order to fully engage the flange spreader shoes.
- At the beginning of the spread operation check the correct full engagement of the flange spreader shoes and the grip between the tool and the flange faces.
- The stepped block shall be inserted into the joint after the tool has reached full advanced open position.
- After positioning the stepped block, working pressure should be lowered gradually in order to set the load onto the stepped block.
- Always ensure that the tool has even and thorough contact with the work piece.



WARNING


Never place fingers in a joint held by activated wedge unless a stepped block is also located within the joint.

CAUTION

- An optional spreader handle is available. SPX recommends the use of this handle to minimize the possibility of operators' fingers being caught within a joint during the extend or retract process.
- Never hammer or force spreader to create or access a gap.
- Don't operate the equipment without lubricating the internal interface between the wedge and the shoes.

WEDGE USE


- It is recommended that two spreaders be used in tandem position. (See fig.1)
- · This will give an even spread to the joint.
- Two hydraulic spreaders can easy be used simultaneously when used in combination with an SPX hand pump, split-flow manifold and hydraulic hoses.

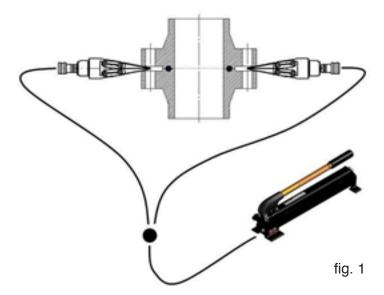


DIMENSIONS / SPECIFICATIONS

FLS15 SPREADER

FLS15-ST SPREADER

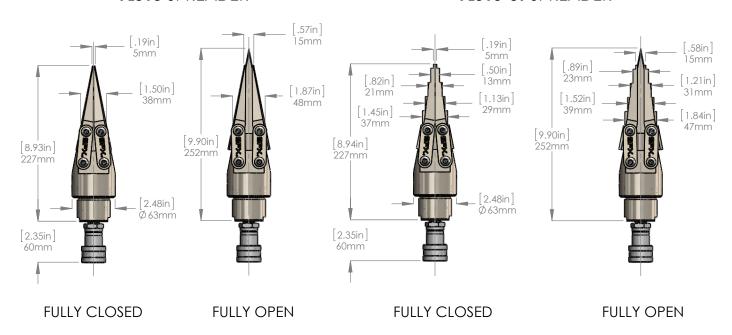


SB15 STEPPED BLOCK

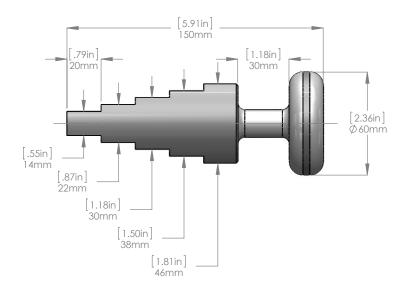


MODEL NUMBERS	MAX. SPREADING FORCE	MIN. REQUIRED ACCESS GAP	TYPE	WEIGHT	MAXIMUM OPERATING PRESSURE
FLS15 &	[33,000 Pounds]	[.197 Inches]	Wedge	[7 pounds]	700 bar
FLS15ST	15 Metric Tons	5mm		3.2 kg	(10,000 psi)


DISASSEMBLY / MAINTENANCE / SERVICE

- Regularly inspect all components to detect any problem requiring service or maintenance.
- To prolong the life of your SPX equipment, follow points below:
- 1. Clean and grease contact surfaces shown below with high pressure quality grease.
- 2. Ensure smooth rotation of link plate joints and keep them lightly greased.
- 3. Keep general tool condition clean.

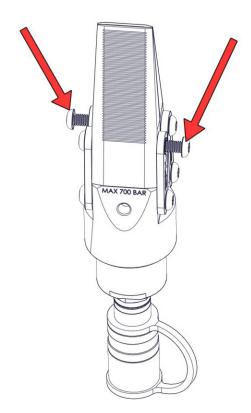

- **(Upper Left Picture)** Unscrew the indicated screws about 4 mm (.2 inches) to "unlock" the shoes. Work the shoes loose from the residual grease to open them.
 - (Lower Right Picture) Clean the indicated surfaces with a degreasing agent. Then, re-grease the same with quality, high-pressure grease. Close the shoes and torque (tighten) the screws to 34 Nm (25 ft. lbs.).

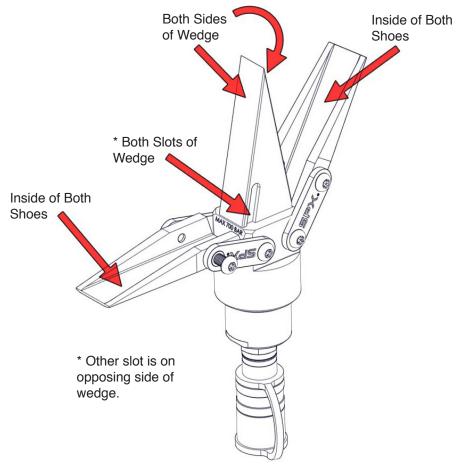

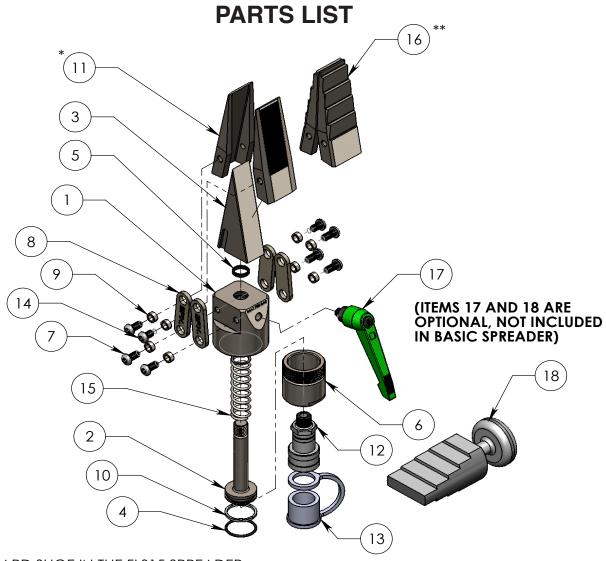

- * STANDARD SHOE IN THE FLS15 SPREADER ** - STANDARD SHOE IN THE FLS15-ST SPREADER
- ITEM NO. PART NUMBER **DESCRIPTION** QTY. MAIN BODY **PISTON ROD WEDGE** O-RING, NBR, 31x2,5 90-SHORE GUIDE RING, 16,0x19,1x4,0 POM CYLINDER, 36MM BORE SCREW, M8 x16, CLASS 10.9, ROUND HEAD, T40, ZINC PLATED. LINK PLATE **JOINT SPACER** BACKUP RING, 31,20x36,00x2,00mm SHOE, SERRATED, FLS15 25600-1 COUPLER, HYD 3/8" NPTF F CPLR, HYD, DUST CAP, RUBBER SCREW, M8 x12, CLASS 10.9, ROUND HEAD, T40, ZINC PLATED. SPRING, COMPRESSION, 242,43N 2,5x81,5 SHOE, STEPPED, FLS15 HANDLE ASSEMBLY STEPPING BLOCK, ALUMINIUM **SB15**

SERVICE KITS

KIT NUMBER	KIT NAME	CONTAINS PARTS	QTY.	DESCRIPTION
3000708	SEAL KIT	20080732008074	1 1	BACKUP RING O-RING
		• 2008076	1	GUIDE RING
3000709	JAW KIT, STEPPED	• 2008083	2	STEPPED SHOE
3000710	WEAR PARTS KIT, SERRATED	200807820080792008082	4 8 2	LINK PLATE JOINT SPACER SERRATED SHOE
3000711	WEAR PARTS KIT, STEPPED	200807820080792008083	4 8 2	LINK PLATE JOINT SPACER STEPPED SHOE

EC DECLARATION OF CONFORMITY



We declare under our sole responsibility that our Flange Spreader Model:

FLS15, FLS15-ST

to which this declaration relates are in conformity with the following:

EN, EN-ISO, ISO standards

Title

Per the provisions of the Machinery Safety Directive

2006/42 EC

EN_ISO 12100:2011

Safety of machinery, basic concepts, general principles for

design, risk assessment & risk reduction

EN 4413:2010

Hydraulic Fluid Power – general rules and safety requirements for systems & their components

We, the undersigned, hereby declare that the equipment specified conforms to the above European Communities Directive(s) and Standard(s).

Eygelshoven April 12, 2013

SPX Hydraulic Technologies 5885 11th Street Rockford, IL 61109-3699 United States of America

SPX Hydraulic Technologies Christophe Bouvet Andreas J. Klemm Albert Thijsstraat 12 Eygelshoven The Netherlands

Christophe Bouvet, Managing Director

Andreas J. Klemm, Appl.Engineering Manager

Form No 10_____ Rev 1 Jan 2, 2013